





**Tuotetiedot**

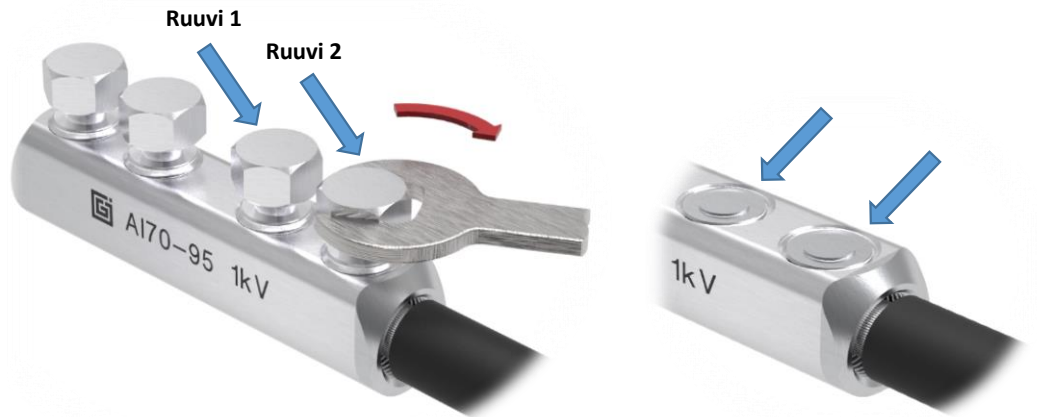
Tuotekoodi	Tuotenimike	AV	Jännite (Un)	Kuorintapituus L	Johdin A
VB04-0027	1 kV Jatkoliitin Al 16-50 mm <sup>2</sup> 2-ruuvinen	11	1 kV	22 mm	Al 16-50 mm <sup>2</sup>
VB04-0016	1 kV Jatkoliitin Al 16-50 mm <sup>2</sup> 4-ruuvinen	11	1 kV	35 mm	Al 16-50 mm <sup>2</sup>
VB04-0028	1 kV Jatkoliitin Al 70-95 mm <sup>2</sup> 2-ruuvinen	14	1 kV	28 mm	Al 70-95 mm <sup>2</sup>
VB04-0017	1 kV Jatkoliitin Al 70-95 mm <sup>2</sup> 4-ruuvinen	14	1 kV	43 mm	Al 70-95 mm <sup>2</sup>
VB04-0018	1 kV Jatkoliitin Al 120-185 mm <sup>2</sup> 4-ruuvinen	18	1 kV	53 mm	Al 120-185 mm <sup>2</sup>
VB04-0019	1 kV Jatkoliitin Al 240-300 mm <sup>2</sup> 4-ruuvinen	22	1 kV	65 mm	Al 240-300 mm <sup>2</sup>
					


**KytKentä**

Kuori kaapeli annettuun kuorintapituuteen L.  
Asenna kaapeli. Kosteissa olosuhteissa  
suosittelemme suojarasvan käyttöä.

Kaapelin kontaktipinnat on harjattava  
teräsharjalla ja käsiteltävä liitosrasvalla  
hapettumien estämiseksi. Sektorikaapeli on  
muokattava pyöreäksi ennen asennusta.

Esikiristä ruuvit. Ensinnä ruuvi 1, varmista ettei  
kaapeli liiku. Esikiristä sitten ruuvi 2.  
Lopullinen kiristysmomentti saavutetaan, kun  
ruuvia kiristetään niin kauan, että ruuvi katkeaa.  
Kiristä ruuvi 2 ensin lopulliseen tiukkuuteen.  
Poista lopuksi terävät tai ulkonevat osat ruuvien  
kannoista.


**Ouneva Oy**

Teollisuustie 21

FI-82730 Tuupovaara

Finland

Tel. +358 400 179 750

[info@ouneva.fi](mailto:info@ouneva.fi)
[www.ounevagroup.fi](http://www.ounevagroup.fi)
[www.ounevaproducts.fi](http://www.ounevaproducts.fi)

Product data					
Product code	Product name	SW	Voltage (Un)	Stripping length L	Conductor A
VB04-0027	1 kV Shear-type splice sleeve Al 16-50 mm <sup>2</sup> 2-screw	11	1 kV	22 mm	Al 16-50 mm <sup>2</sup>
VB04-0016	1 kV Shear-type splice sleeve Al 16-50 mm <sup>2</sup> 4-screw	11	1 kV	35 mm	Al 16-50 mm <sup>2</sup>
VB04-0028	1 kV Shear-type splice sleeve Al 70-95 mm <sup>2</sup> 2-screw	14	1 kV	28 mm	Al 70-95 mm <sup>2</sup>
VB04-0017	1 kV Shear-type splice sleeve Al 70-95 mm <sup>2</sup> 4-screw	14	1 kV	43 mm	Al 70-95 mm <sup>2</sup>
VB04-0018	1 kV Shear-type splice sleeve Al 120-185 mm <sup>2</sup> 4-screw	18	1 kV	53 mm	Al 120-185 mm <sup>2</sup>
VB04-0019	1 kV Shear-type splice sleeve Al 240-300 mm <sup>2</sup> 4-screw	22	1 kV	65 mm	Al 240-300 mm <sup>2</sup>

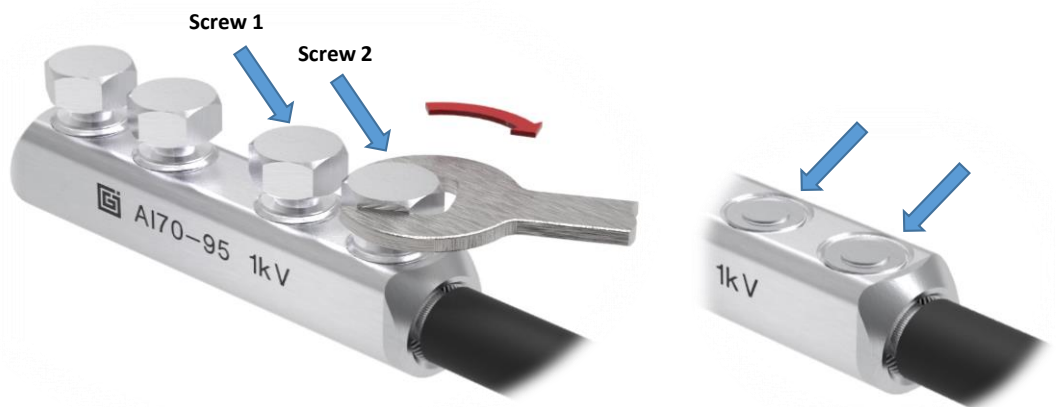

**Installation**

Strip the conductor to the stripping length L.  
Insert conductor. Using protection grease is recommended in wet conditions.

Brush the contact surface with a wire brush and lubricate lightly with grease in order to prevent oxidation.

Sector shaped cable must be pre-rounded before installation.

Pre-tighten the screws: First screw 1, make sure that the cable does not move, then pre-tighten screw 2. Finally, tighten the bolts until the stub breaks off. Remove any sharp edges from the screw stem.


**Ouneva Oy**

Teollisuustie 21

FI-82730 Tuupovaara

Finland

Tel. +358 400 179 750

[info@ouneva.fi](mailto:info@ouneva.fi)
[www.ounevagroup.fi](http://www.ounevagroup.fi)
[www.ounevaproducts.fi](http://www.ounevaproducts.fi)